SAMSUNG ELECTRONICS

SERVICE BULLETIN

Product :	DVDP	Bulletin No. :	98-DVD-E0001
Model :	DVD905	Bulletin Date :	MAR.23.1998
Buyer :	SEA	ECN # & Date :	MAR.23.1998

SUBJECT : DVD905 SYNC TROUBLE(TXG2548 TV)

Background : In the conncting with the TXG2548 TV, the picture is scrambled.
(Symptom)

Cause : Too small Sync level

Solutions : * Change VR56 from 220 ohm to 200 ohm(1% tolerance)
* Change R7 from 240 ohm to 220 ohm(1% tolerance)

Application Date : RUNNING CHANGE

(* I.C : Interchangeability Code Type)

Location No.	OLD (before) Parts		NEW (changed) Parts		*
	SEC Code	Description	SEC Code	Description	I.C
VR56	2007-000572	R-CHIP; 220 OHM	2007-000011	R-CHIP; 200 OHM	C
VR7	2007-001657	R-CHIP; 240 OHM	2007-000569	R-CHIP; 220 OHM	C

Type	A type	B type	C type	D type	E type	F type
Interchange-ability Code (* I.C)	OLD (Part) NEW → Early (Time) Late	OLD (Part) NEW → Early (Time) Late	OLD (Part) NEW → Early (Time) Late	OLD (Part) NEW → Early (Time) Late	Part Addition (¡¿ ¡æ NEW)	Part deletion (OLD ¡æ ¡¿)

Application : Reference ( ) Only Defected sets ( ) Whole sets (O)

Attachment : Schematic Diagram ( ) Component Lay-out ( ) Exploded View ( )
Mechanical Diagram ( ) P.C.B ( ) None (0)

Product Month :		Serial No. (~ from)
Published by :	Checked by :	Approved by :

SAMSUNG ELECTRONICS

SERVICE BULLETIN

Product :	DVD	Bulletin No. :	99-DVD-E0001
Model :	DVD-907/927	Bulletin Date :	Feb. 03. 1999
Buyer :	SEA(USA)	ECN Date :	Feb. 03. 1999

SUBJECT : DVD-907/927 Picture Problum

Background : - The Picture is stilled When interleaved block playing in opposite area of Dual Layer Disc.

(Symptom)

¢¹ Hust micom program change

Note :

¢¹Before Change : Micom Ver 2.14(1102-000135 , IC-EPROM;27C020)

¢¹After Change : Micom Ver 2.16(1102-000135 , IC-EPROM;27C020)

Application Date : Immediately

(Interchangeability Code : * I.C)

Location No.	OLD (before) Parts		NEW (changed) Parts		* I.C
	SEC Code	Description	SEC Code	Description	
MIC2	1102-000135	IC-EPROM;27C020	1102-000135	IC-EPROM;27C020	

Type	A type	B type	C type	D type	E type	F type
Interchange Type Code (* I.C)	OLD (Parts) NEW / Early (Prod.) Late	OLD (Parts) NEW / Early (Prod.) Late	OLD (Parts) NEW / Early (Prod.) Late	OLD (Parts) NEW / Early (Prod.) Late	Parts Addition (None ¡æ New)	Parts deletion (Old ¡æ Del.)

Application Reference (O) Only Defected sets ( ) Whole sets ( )

Attachment Schematic Diagram ( ) Component Lay-out ( ) Exploded View ( )

Mechanical Diagram ( ) None (O) Others ( )

Product Month : JAN. 20. 1999 Serial No. (~ from) : 62KK100001¡-

Published by : Checked by : Approved by M. J. SON

SAMSUNG ELECTRONICS

SERVICE BULLETIN

Product:	**DVD**	**Bulletin No.:**	**00-UA-DVD-E0001**
Model:	**DVD-909**	**Bulletin Date:**	**Mar.27.2000**
Buyer:	**XEV**	**ECN Date:**	**Mar.27.2000**
SUBJECT:	**DVD-909. Sound problem**		

Background: (Symptom) **Audio signal is absent in Surround outputs.**

Reason: **Some elements are missing**

Solution: **Add missing parts**

Change:
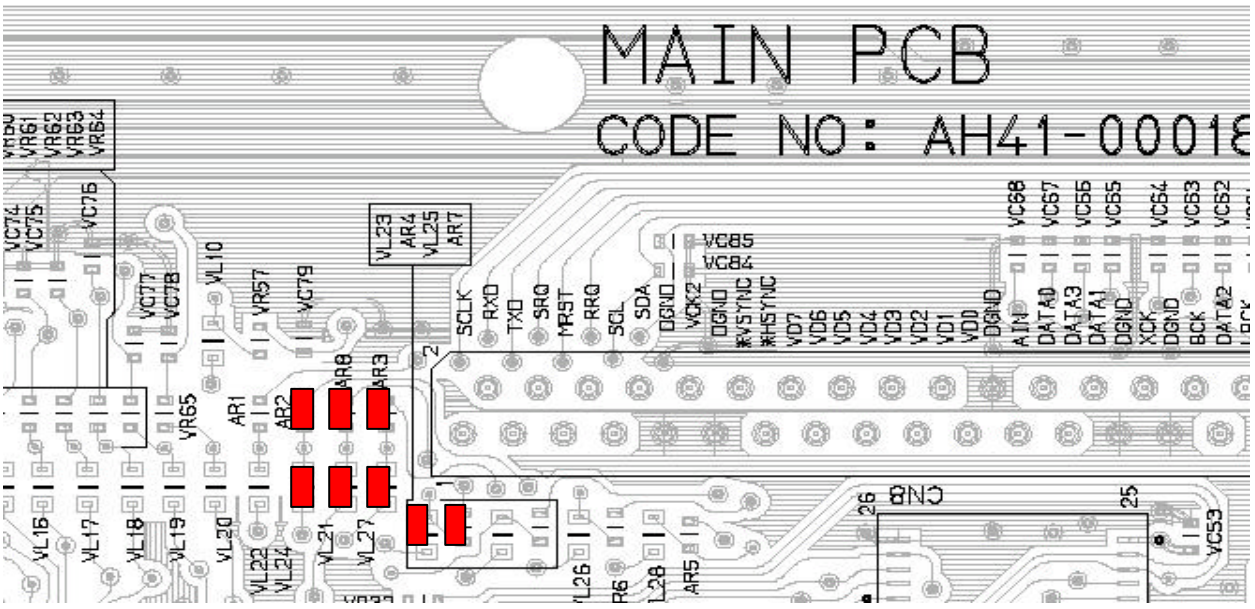
Location No	OLD (before) Parts		NEW (changed) Parts	
	SEC Code	Description	SEC Code	Description
VL21			3301-000353	CORE-FERRITE BEAD;AB,2.0
VL23			3301-000353	CORE-FERRITE BEAD;AB,2.0
VL24			3301-000353	CORE-FERRITE BEAD;AB,2.0
VL27			3301-000353	CORE-FERRITE BEAD;AB,2.0
AR2			2007-000308	R-CHIP;10OHM,5%,1/10W,DA,
AR3			2007-000308	R-CHIP;10OHM,5%,1/10W,DA,
AR4			2007-000308	R-CHIP;10OHM,5%,1/10W,DA,
AR8			2007-000308	R-CHIP;10OHM,5%,1/10W,DA,